



GEOTECHNICAL & MATERIALS
 ENGINEERING, TESTING & INSPECTION
 P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821 CA No.1450

SIEVE ANALYSIS

PROJECT: Product Check
 53rd St. Yard

PROJECT NO: TL-8047

DATE: March 24, 2014

CLIENT: Transcor Recycling LLC

LAB NO.: 19673

SAMPLE LOCATION: 53rd Street Processing Facility – Stockpile

SAMPLE DESCRIPTION: Coarse Aggregate - No. 89 – Limestone

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>No. 89 Aggregate ASTM C 33</u>
3/4"	100	100
1/2"	99	100
3/8"	93	90-100
No. 4	31	20-55
No. 8	7	5-30
No. 16	3	0-10
No. 30	3	---
No. 50	2	0-5


FINENESS MODULUS: 5.60

DATE SAMPLED: 3/19/14

DATE TESTED: 3/21/14

REPORTS TO:

Email:
 Candice Agosto at cagosto@transcorrecycling.com

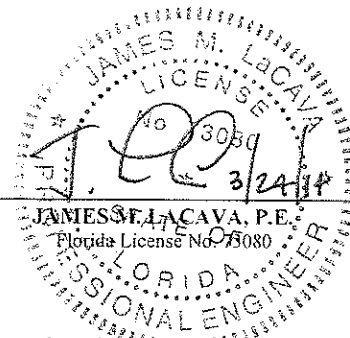

dl\svs.387