

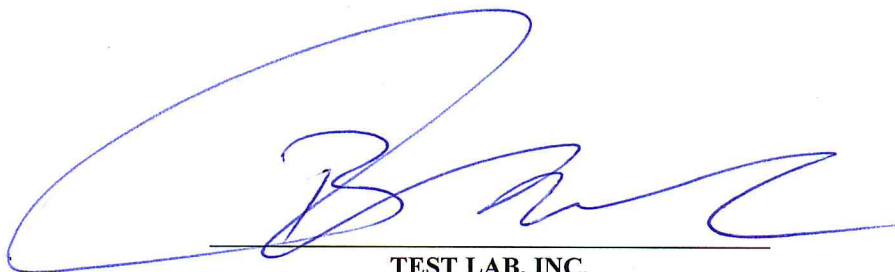
**TEST LAB** INC.GEOTECHNICAL & MATERIALS  
ENGINEERING, TESTING & INSPECTION

P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821

CA No.1450

**PROJECT:** FDOT Product Testing - P.O.#7001-95000**PROJECT NO:** TL-8047-A**CLIENT:** Kimmins Contracting Corporation**DATE:** September 6, 2011**LAB NO.:** 17954**SAMPLE LOCATION:** 53<sup>rd</sup> Street Processing Facility – Northeast Side of Production Stockpile**SAMPLE DESCRIPTION:** Crushed Concrete (Roadbase Material)

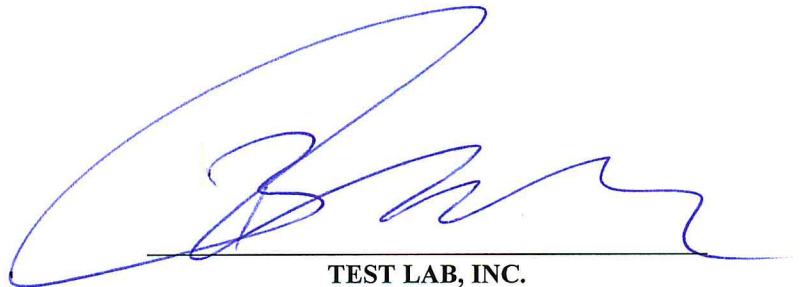
<u>Sieve Number</u>	<u>Percent Passing</u>	<u>Material Type B-12 FDOT Specifications</u>
2"	100	100
1-1/2"	100	---
3/4"	85	65-95
3/8"	58	40-85
No. 4	41	25-65
No. 10	31	20-50
No. 50	14	5-25
No. 100	8	---
No. 200	4.9	0-10

**WASH 200:** 4.7%**ATTERBERG LIMITS:** LL: NP PL: NP PI: NP**DELETERIOUS MATERIAL:** Wood: 0.04% Bricks: 0.8% Bitumen: 1.0%**FDOT SAMPLE NO.:** 113501**LIMS NO.:** 1100108595**DATE SAMPLED:** 9/1/11**DATE TESTED:** 9/6/11**REPORTS TO:**Email:  
ewilhelm@kimmins.com


TEST LAB, INC.

**PROJECT:** FDOT Product Testing - P.O.#7001-95000**PROJECT NO:** TL-8047-A**CLIENT:** Kimmins Contracting Corporation**DATE:** September 6, 2011**LAB NO.:** 17955**SAMPLE LOCATION:** 53<sup>rd</sup> Street Processing Facility – Southwest Side of Production Stockpile**SAMPLE DESCRIPTION:** Crushed Concrete (Roadbase Material)

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>Material Type B-12 FDOT Specifications</u>
2"	100	100
1-1/2"	100	---
3/4"	91	65-95
3/8"	71	40-85
No. 4	56	25-65
No. 10	45	20-50
No. 50	20	5-25
No. 100	12	---
No. 200	6.8	0-10

**WASH 200:** 6.1%**ATTERBERG LIMITS:** LL: NP PL: NP PI: NP**DELETERIOUS MATERIAL:** Wood: 0.05% Bricks: 0.2% Bitumen: 1.4%**FDOT SAMPLE NO.:** 113502**LIMS NO.:** 1100108597**DATE SAMPLED:** 9/1/11**DATE TESTED:** 9/6/11**REPORTS TO:**Email:  
ewilhelm@kimmins.com


TEST LAB, INC.