


SIEVE ANALYSIS



GEOTECHNICAL & MATERIALS
ENGINEERING, TESTING & INSPECTION
P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821 CA No.1450

PROJECT: Product Check - P.O. No. 7001-95000
53rd Street Yard

PROJECT NO: TL-8047

CLIENT: Transcor Recycling LLC

DATE: 12/7/2017

LAB NO.: 22655

SAMPLE LOCATION: Stockpile at 53rd Street Yard (South side of pile)

SAMPLE DESCRIPTION: Light brown silty SAND

<u>Sieve Number</u>	<u>Percent Passing</u>
1 1/2"	100.0
1"	97.9
3/4"	96.9
1/2"	95.2
3/8"	94.8
No. 4	91.8
No.10	89.1
No. 40	84.9
No. 60	73.3
No. 100	42.8
No. 200	13.3


ORGANIC CONTENT: Sample #1: 0.6% Sample #2: 0.7% Sample #3: 0.7 Average: 0.7

ATTERBERG LIMITS: LL: NP PL: NP PI: NP

SOIL CLASSIFICATION: A-2-4

DATE SAMPLED: 11/29/17

DATE TESTED: 12/7/17

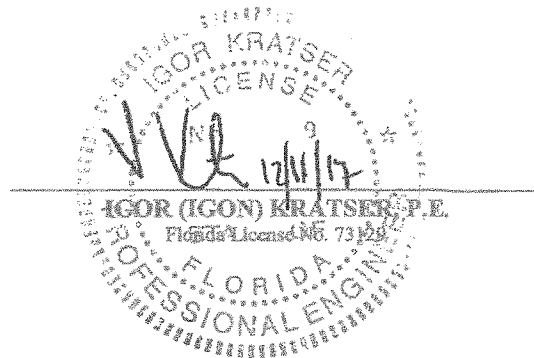

SIEVE ANALYSIS



GEOTECHNICAL & MATERIALS
 ENGINEERING, TESTING & INSPECTION
 P.O. BOX 15732 - TAMPA, FLORIDA 33684 • 813/872-7821 CA No.1450

PROJECT: Product Check - P.O. No. 7001-95000
 53rd Street Yard

PROJECT NO: TL-8047

CLIENT: Transcor Recycling LLC

DATE: 12/7/2017

LAB NO.: 22656

SAMPLE LOCATION: Stockpile at 53rd Street Yard (North side of pile)

SAMPLE DESCRIPTION: Light brown silty SAND

<u>Sieve Number</u>	<u>Percent Passing</u>
1 1/2"	100.0
1"	99.1
3/4"	96.6
1/2"	95.7
3/8"	94.8
No. 4	91.2
No.10	88.5
No. 40	84.3
No. 60	73.3
No. 100	45.2
No. 200	15.8

ORGANIC CONTENT: Sample #1: 0.7% Sample #2: 0.7% Sample #3: 0.7 Average: 0.7

ATTERBERG LIMITS: LL: NP PL: NP PI: NP

SOIL CLASSIFICATION: A-2-4

DATE SAMPLED: 11/29/17

DATE TESTED: 12/7/17



SA.463.Lab#22656

This report contains information that is intended solely for the use of the client and noted assigns.
 This report shall not be reproduced, except in full, without written approval of Test Lab, Inc.