



GEOTECHNICAL & MATERIALS
ENGINEERING, TESTING & INSPECTION
P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821 CA No.1450

PROJECT: Product Check - P.O. No. 7001-95000
53rd St. Yard

PROJECT NO: 1610.23.1

DATE: 2/2/2026

CLIENT: Transcor Recycling LLC

LAB NO.: B-15970


SAMPLE LOCATION: (Sampled by Client)

SAMPLE DESCRIPTION: Crushed Concrete (County Road Base)

**Material Type B-12
FDOT Specifications
Uncertified**

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>Uncertified</u>
1 1/2"	100	---
1"	94	---
3/4"	79	65-95
1/2"	62	---
3/8"	55	---
No. 4	42	25-65
No. 10	36	20-50
No. 50	20	5-30
No. 100	10	---
No. 200	3.3	0-10

DATE SAMPLED: 1/26/2026
DATE RECEIVED: 1/26/2026
DATE TESTED: 2/2/2026
SAMPLED BY: Client
TESTED BY: MD

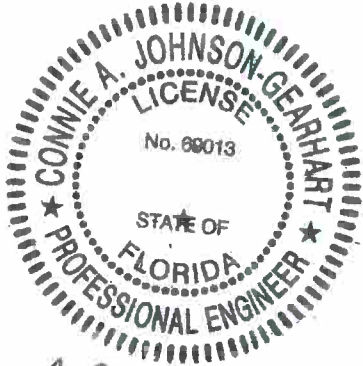

Connie A. Johnson-Gearhart
CONNIE A. JOHNSON-GEARHART, P.E. 2/4/26
Florida License No. 69013




GEOTECHNICAL & MATERIALS
ENGINEERING, TESTING & INSPECTION

P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821 CA No. 1450

PROJECT: Product Check
ADDRESS: 53rd Yard
CLIENT: Transcor

LIMEROCK BEARING RATIO TEST
TEST METHOD: FDOT FM 5-515


PROJECT NO: 1610.23.1
DATE: February 2, 2026
LAB NO: B-15970

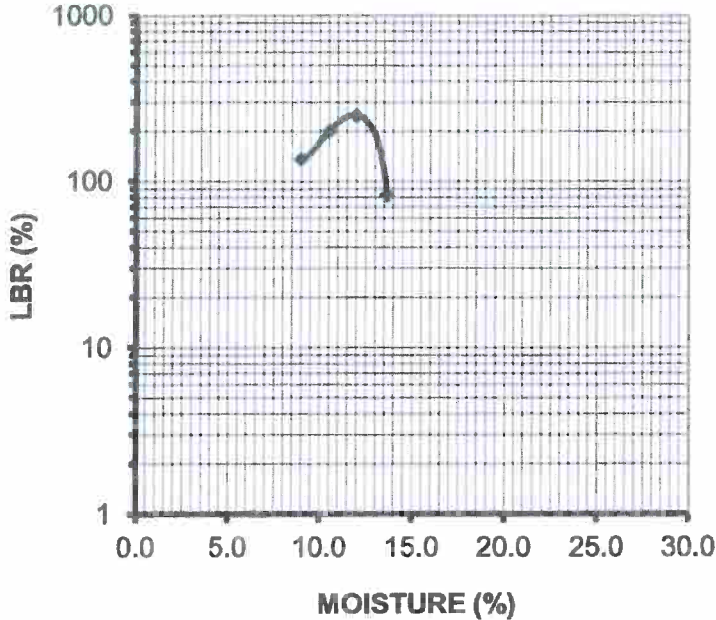

LBR TEST NO: 13
COMPACTION TEST NO.: 15
MAXIMUM LBR VALUE (%): 249
MAXIMUM DRY DENSITY (PCF): 118.4
OPTIMUM MOISTURE (%): 11.4
DATE SAMPLED: 01/26/26
SAMPLED BY: client
DATE TESTED: 02/02/26
TESTED BY: MD

LOCATION SAMPLED: (Sampled by Client)


SOIL DESCRIPTION: Crushed Concrete - County Roadway Base

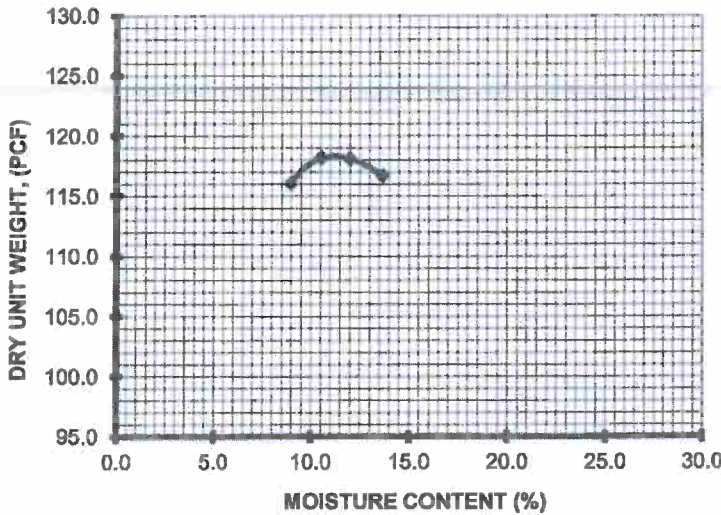

TYPE OF MATERIAL: Base

SOAKING TIME (HRS): 48±4
SOAKING SURCHARGE (LBS): 2.5
TESTING SURCHARGE (LBS): 0

REMARKS:

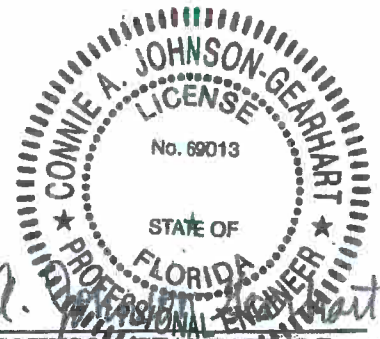

Connie A. Johnson-Gearhart
CONNIE A. JOHNSON-GEARHART, P.E.
Florida License No. 69013 2/4/26

This report contains information that is intended solely for the use of the client and noted assigns.
This report shall not be reproduced, except in full, without written approval of Test Lab, Inc.